


Restoration Guide Post 60k TR3A through TR3B

Category: Underhood

Example Shown: TCF TR3B

Component(s): Steering, Tachometer Cable, Washer Bottle Hose, Fender Mounting Plate

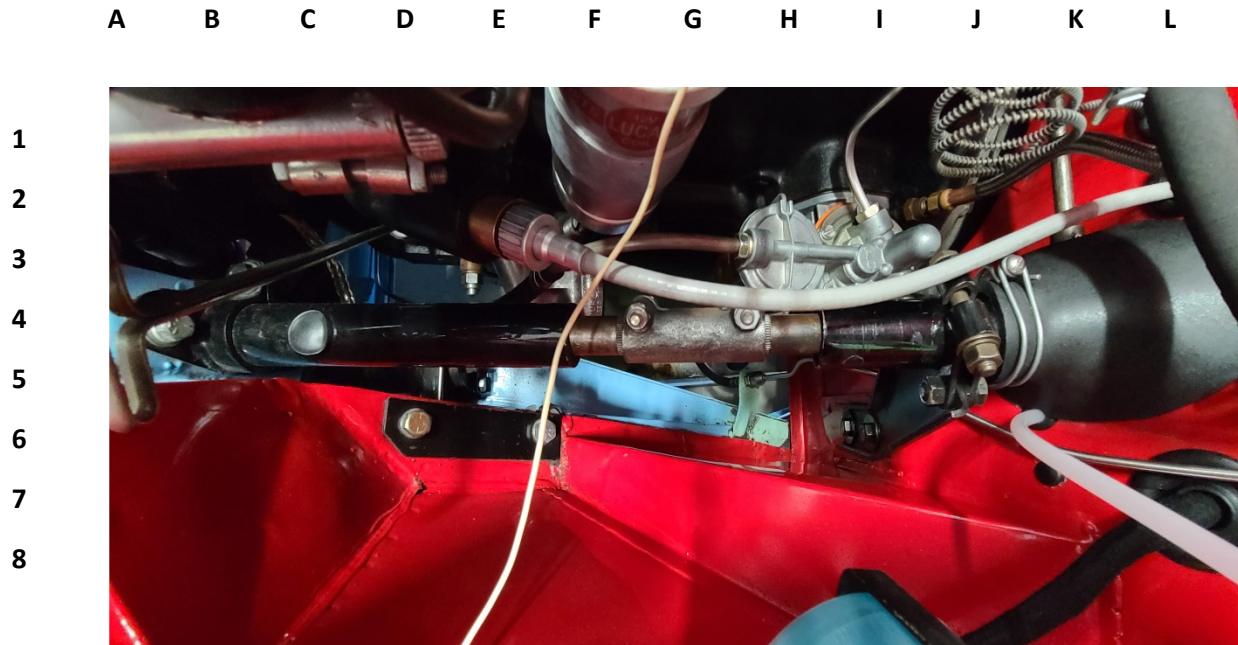

Discussion: At G4, Split steering clamp and exposed inside shaft are natural finish, rest of shaft is painted gloss black.

At C4, rubber plug covers steering box fluid fill hole.

At J5, Upper support bracket painted gloss black, was added with split steering.

At K4, rubber steering boot attached with wire clamp.

At E2, grey tachometer cable attached to distributor pedestal, earlier cars had black cables.

At J5, shown is the routing for white washer bottle hose, not necessarily correct. Hose may be routed almost anywhere through the bulkhead, preferable further to the passenger side, closer to the washer pump.

At D6, Inner fender mounting plate is painted semi-gloss black.